

ADL-08-2026

INSPECTION REPORT FOR NAVRACHANA HIGHER SECONDARY SCHOOL

Name of property : **NAVRACHANA HIGHER SECONDARY SCHOOL**

Location : New Sama Road
Vadodara.

Name of Occupier : **NAVRACHANA EDUCATION SOCIETY**

Type of Structure : BRICK MASONARY & R.C.C.

Date of Inspection : 01st August 2026

Purpose of Inspection : To comply Circular No: 28/2004 dated 26th July 2004
Issued by Central Board of Secondary Education.

I have inspected the site on dated 01st August 2026 as requested by the principal **Navrachana Higher Secondary School**.

The property is being used as a school building by Navrachana Higher Secondary School.

The property is situated at New Sama Road, Vadodara. The property consists of total Six buildings. Building no. 1 to 5 consists of Ground Floor + Two Storey. Building no.6 consist of Basement + Ground Floor + 3 Storey. It was constructed as a R.C.C. frame structure and Masonary Load bearing structure containing foundation, columns, beams, slab etc.

The following observations have been marked as per Circular No: 28/2004 dated 26th July 2004 issued by Central Board of Secondary Education, during inspection.

CIN No. U45309GJ2018PLC102134

Regd. Office : B-142-143, Emaraad One, Winword Business Center, Jetapur Road, Vadodara-390007

☎ +91-96876 91493

✉ info@adstruct.in / dhrumesh@yahoo.co.in

🌐 www.adstruct.in

Sr. No.	Remark	Observation
1.	Does school have any temporary structure or any class room /other room which has thatched roofing and which is inflammable?	No
2.	Is school situated in old or dilapidated buildings?	The school building construction is old but well maintained
3.	Has the building been certified as safe for housing the students by the local authorities?	Yes
4.	Are there any cracks in the school structures and are steps being taken to repair?	No cracks observed.
5.	Is school located near railway track?	No.
6.	Is school is situated in the earthquake risk zone.	No
7.	Have necessary steps been taken during construction of the building for earthquake safety for the building?	Yes
8.	How safe is your construction to face a natural disaster of this kind?	The building is structurally designed as per relevant IS codes applicable for safety against natural disaster.
9.	What emergency steps are in place in the school for disaster preparedness?	Emergency Alarms and contact with disaster management authority of government.
10.	Is there a trained disaster management group available in school for initial response? Or is school in touch with the local disaster management authorities for training and retraining them?	The school has trained staff with such type of group in the school premises and also school is having in touch with local disaster management authorities.

By the inspection of the site and considering the above points, I am of the opinion that presently the building is safe, stable and serviceable. The building remains continue to utilize as a school building. This opinion is given only on the basis of visual observations. No specific tests are carried out.

The above inspection report is given on the basis of the personal site visit and the information provided by the school.

This report is valid for 2(Two) years from the date of issue.

Date: 03rd August 2026

Place: Vadodara

DHRUMESH SHAH

B.E. Civil, M.I.E., FIV, FIGV
ACI Arb, MIIT Arb, MICA, ACFE
Consulting Structural Engineer
Chartered Engineer
Govt. Approved Valuer

VMSS LIC. No SEOR- 01-111-26-29

DHRUMESH G. SHAH
STRUCTURAL ENGINEER
VMSS LIC. No. SEOR-1/111/26-29
303, CENTRE POINT,
R.C. DUTT ROAD, ALKAPURI,
VADODARA-390007.

CIN No. U45309GJ2018PLC102134

Regd. Office : B-142-143, Emaralad One, Winword Business Center, Jetalpur Road, Vadodara-390007

☎ +91-96876 91493

✉ info@adstruct.in / dhrumesh@yahoo.co.in

🌐 www.adstruct.in